



SECULIFE | HITAM TRMS-Medical-Multimeter (antimicrobial)

3-349-453-03 6/11.15

Features

Digital TRMS handheld multimeter with 23 functions

- Voltage measurement
- Auto-ranging current measurement from 100 μA (resolution: 10 nA) to 10 A (16 A)
- Capacitance and resistance measurement, diode and continuity testing
- Measuring categories: 600 V CAT III and 300 V CAT IV
- 1 kHz low-pass filter
- TRMS AC and AC+DC, 20 kHz bandwidth
- Data memory for more than 15,000 measured values
- · Housing and protective rubber holster with atimicrobial properties

Interface

- Bidirectional infrared interface for communication with the PC (38.4 kBd)
- IR-USB adapter available as option

Power Supply

- Battery operation
- Mains operation via optional broad range variable power pack (95 to 250 V~)

CAT IV









D-K-15080-01-01 DAkkS Calibration Certificate as Standard Feature

Applications

The multimeter has been designed especially for use in the field of medical technology, amongst other purposes for servicing, repairing and testing medical devices.

Features

The multimeters of the **SECULIFE HITAM** series have been endowed with antimicrobial properties. This is to curb the growth of germs, counteract microbial colonization or kill microorganisms.

Three Connector Jacks with Automatic Blocking Sockets (ABS) *

All current ranges are implemented via a single connector jack which prevents any possibility of operator error.

Beyond this, the automatic blocking sockets prevent incorrect connection of the measurement cables, as well as selection of the wrong measured quantity. Danger to the user, the instrument and the device under test resulting from operator error is thus ruled out.

* Patented (patent no. EP 1801 598 and US 7,439,725)

Overload Protection

The instrument is safeguarded for up to 1000 V in all measuring functions by overload protection. Voltages of greater than 1000 V and current of greater than 10 or 16 A are indicated acoustically. Dangerous contact voltages are indicated when the 1 kHz low-pass filter is activated.

The FUSE display appears in order to indicate that the fuse for the current measuring input has blown.

RMS Value with Distorted Waveshape

The utilized measuring method allows for waveshape independent RMS measurement (TRMS AC and AC+DC) for voltage and current up to 20 kHz.

Activatable Filter for V AC Measurement

A 1 kHz low-pass filter can be activated if required, for example when measuring at electronic frequency converters or switched-mode power supplies.

High Voltage sensor

The input signal is examined for contact danger regardless of the selected input function or filtering.

Measuring 5 V Square-Wave Signals

This function makes it possible to test circuits and transmission cables by measuring the frequency and the keying ratio of pulses with amplitudes of 2 to 5 V and frequencies of 100 Hz to 1 MHz.

Analog Scale for Quick Trend Display - Bar Graph or Pointer

The analog scale (with additional negative range for zero-frequency quantities) allows for faster recognition of measured value fluctuation than is possible with a digital display. The instrument can be switched back and forth between bar graph and pointer display.

Automatic or Manual Measuring Range Selection

Measured quantities are selected by means of a rotary switch and a function key. The measuring range is automatically matched to the measured values. The measuring range can also be selected and fixed manually with a key.

TRMS-Medical-Multimeter (antimicrobial)

Fast Acoustic Continuity Test

Testing for short circuiting and interruption is possible with the selector switch in the (1) position. The threshold value for acoustic signaling can be set to 1, 10, 20, 30, 40 or 90 Ω .

Automatic Storage of Measured Values *

The DATA function automatically saves the digitally displayed measured value after settling in. Acoustic signaling is also used to indicate whether the new measured value deviates from the initial reference value by less or more than 0.1% of the measuring range.

* Patented

Storage of Min-Max Values

Comparable to the slave-pointer function of an analog instrument, the device saves the highest and lowest measured values after the MIN/MAX function has been activated or reset. These extreme values can be queried at the display. The values are acquired using an especially fast sampling rate (40 measurements per second).

Battery Charging Status - Power Saving Circuit

The battery charge level is indicated by means of a 4-segment symbol.

The device is switched off automatically if the measured value remains unchanged for a period of between 10 and 59 minutes (adjustable), and if none of the controls are activated during this time. Automatic shutdown can be deactivated by switching the instrument to continuous operation.

Protective Cover for Harsh Conditions

The instrument is protected against damage in the event of impacts or dropping by means of a soft rubber cover with tilt stand and test probe holder. The rubber material also assures that the instrument does not wander if it is set up on a vibrating surface.

Infrared Data Interface

The device can be remote configured, and momentary and stored measurement data can be read out via the bidirectional infrared interface. The USB X-TRA interface adapter and METRAwin 10 software are required to this end (see accessories). Interface protocol and device driver software for LabVIEW $^{\textcircled{\$}}$ (National Instruments™) are available upon request.

The infrared interface can be switched off in the standby mode.

DAkkS Calibration Certificate

The multimeters are furnished with an internationally valid DAkkS calibration certificate (recognized by EA and ILAC). After the specified calibration interval has elapsed (recommended interval: 1 to 3 years), the multimeters can be inexpensively recalibrated in our own DAkkS calibration laboratory.

Applicable Regulations and Standards

IEC/DIN EN 61010 -1 VDE 0411-1	Safety requirements for electrical equipment for measurement, control and laboratory use
DIN EN 61 326-1 VDE 0843-20-1	Electrical equipment for measurement, control and laboratory use – EMC requirements – Part 1: General requirements
DIN EN 60529 DIN VDE 0470-1	Test instruments and test procedures – degrees of protection provided by enclosures (IP code)

Functions

Voltage V_{AC} TRMS (Ri $\geq 9 \text{ M}\Omega$)	100 mV / 1 V / 10 V / 100 V / 1000 V
Frequency Hz @ V _{AC}	100 Hz / 1 kHz / 10 kHz / 100 kHz
Voltage Lo ¹⁾ V_{AC} TRMS (Ri = 1 M Ω)	100 mV / 1 V / 10 V / 100 V / 1000 V
Frequency Hz @ Lo 1) V _{AC}	100 Hz / 1 kHz / 10 kHz / 100 kHz
Low-pass filter	1kHz\ @ Lo V _{AC} or @ Hz
Voltage V_{DC} (Ri $\geq 9 M\Omega$)	100 mV / 1 V / 10 V / 100 V / 1000 V
Voltage V_{AC+DC} TRMS (Ri $\geq 9M\Omega$)	100 mV / 1 V / 10 V / 100 V / 1000 V
Bandwidth @ V _{AC+DC} or V _{AC}	20 kHz
Frequency MHz @ 5 V AC	100 Hz1 MHz
Duty cycle %	2,0 % 98 %
Resistance Ω	$100\Omega/1k\Omega/10k\Omega/100k\Omega/$ $1M\Omega/10M\Omega/40M\Omega$
Continuity test (1)	$0 \dots 100 \Omega @ I_{CONST} = 1 mA$
Diode measurement	0 5,1 V @ I _{CONST} = 1 mA
Temperature measurement °C / °F @ T _C	Thermocouple Type K
Temperature measurement °C / °F @ R _{TD}	Pt100 / Pt1000
Capacitance measurement F	10 nF / 100 nF / 1 μF / 10 μF / 100 μF / 1000 μF
Current A _{DC}	100 μA / 1 mA / 10 mA / 100 mA / 1 A / 10 A (16 A)
Current A _{AC+DC} TRMS	100 μA / 1 mA / 10 mA / 100 mA / 1A / 10 A (16 A)
Current A _{AC} TRMS	100 μA / 1 mA / 10 mA / 100 mA / 1 A / 10 A (16 A)
Bandwidth @ A _{AC+DC} or A _{AC}	10 kHz
Frequency Hz @ A _{AC}	100 Hz / 1 kHz / 10 kHz / 30 kHz
Data logger function ²⁾ (memory)	4 Mbit = 500 kByte = 15400 measured values
IR-Interface	38400 Bd
Power pack connector socket	✓
Protection 3)	IP52
Measurement category	600 V CAT III and 300 V CAT IV
DAkkS calibration certificate	✓
Protective rubber cover	✓

- 1) Alternating voltage measurement with specially reduced input impedance
- 2) Sampling rate adjustable from 0.1 seconds to 9 hours 3) IP65 available with the METRAHIT OUTDOOR model

Included

- multimeter
- pair of safety measurement cables antimicrobial (1.5 m) with 4 mm test probes, 600 V CAT III, 300 V CAT IV (KS17-2AMB)
- batteries, 1.5 V, type AA
- condensed operating instructions, English/German
- CD ROM, content: operating instructions in English and
- DAkkS calibration certificate
- protective rubber cover antimicrobial
- HC20 hard case

Voluntary Manufacturer's Guarantee

24 months for materials and workmanship

1 to 3 years for calibration (depending upon application)

TRMS-Medical-Multimeter (antimicrobial)

Characteristic Values

Meas			n at Upper e Limit	Input In	npedance		certainty under Reference		Overload (Capacity ²⁾
Function	Measuring Range	11999	1199			±(%rdg. + d)	±(%rdg. + d)	±(%rdg. + d)	Value	Time
	1001/		1199	==	~/≅					Time
	100 mV	10 μV		≥9 MΩ	≥9 MΩ // < 50 pF	0.09 + 5 mit ZERO	1 + 30 (> 300 d) 1)	1 + 30 (> 300 d) 1)	1000 V DC	
v	1 V 10 V	100 μV		≥9 MΩ	≥9 MΩ // < 50 pF	0.05 + 3	0.5 + 9 (> 200 d)	1 + 30 (> 300 d)	AC	
v		1 mV		≥9 MΩ	≥9 MΩ // < 50 pF	0.05 + 3	0.5 + 9 (> 200 d)	1 + 30 (> 300 d)	RMS	continous
	100 V 1000 V	10 mV		≥9 MΩ	≥9 MΩ // < 50 pF	0.05 + 3 0.09 + 3	0.5 + 9 (> 200 d)	1 + 30 (> 300 d)	sine 6)	
	1000 V	100 1110		≥9 MΩ	≥9 MΩ // < 50 pF		0.5 + 9 (> 200 d) ~ 10)	1 + 30 (> 300 d) ≅ ¹⁰⁾		
	100 1	101			x. at upper range limit					
	100 μΑ	10 nA		12 mV	12 mV	0.5 + 5	1.5 + 10 (> 200 d)	1.5 + 30 (> 200 d)		
	1 mA	100 nA		120 mV	120 mV	0.5 + 3	1.5 + 10 (> 200 d)	1.5 + 30 (> 200 d)	0.2 A	continous
Α	10 mA	1 μΑ		16 mV	16 mV	0.5 + 3	1.5 + 10 (> 200 d)	1.5 + 30 (> 200 d)		
	100 mA	10 μΑ		160 mV	160 mV	0.5 + 3	1.5 + 10 (> 200 d)	1.5 + 30 (> 200 d)		14)
	1 A	100 μΑ		40 mV	40 mV	0.9 + 10	1.5 + 10 (> 200 d)	1.5 + 30 (> 200 d)	10 A: ≤ 5 16 A: ≤	5 min 11)
	10 A	1 mA		600 mV	600 mV	0.9 + 10	1.5 + 10 (> 200 d)	1.5 + 30 (> 200 d)	10 A. ≤	30 8
					Meas. curr. @ range limit		g. + d)			
	100 Ω	10 mΩ		< 1.4 V	Approx. 300 μA		with active ZERO function			
	1 kΩ	100 mΩ		< 1.4 V	Approx. 250 µA	0.2 + 5				
	10 kΩ	1 Ω		< 1.4 V	Approx. 100 μA	0.2 + 5			1000 V	
Ω	100 kΩ	10 Ω		< 1.4 V	Approx. 12 μA	0.2 + 5			DC	
	1 MΩ	100 Ω		< 1.4 V	Approx. 1.2 μA	0.2 + 5	•		AC RMS	Max. 10 s
	10 MΩ	1 kΩ		< 1.4 V	Approx. 125 nA	0.5 + 10			sine	
4)	40 MΩ	10 kΩ		< 1.4 V	Approx. 20 nA	2.0 + 10	J			
ц))	100 Ω		0.1 Ω	Approx. 8 V	Approx. 1 mA const.	3 + 5				
→	5.1 V ³⁾	_	1 mV	Approx. 8 V	Approx. 1 mA const.	0.5 + 3				
				Discharge resist.	U _{0 max}		g. + d)			
	10 nF		10 pF	10 MΩ	0.7 V		with active ZERO function			
	100 nF		100 pF	1 ΜΩ	0.7 V	1 + 6 4)			1000 V	
F	1 μF		1 nF	100 kΩ	0.7 V	1 + 6 4)			1000 V DC AC	Max. 10 s
	10 μF		10 nF	12 kΩ	0.7 V	1 + 6 4)			RMS	
	100 μF		100 nF	3 kΩ	0.7 V	5 + 6 ⁴⁾			sine	
	1000 μF		1 μF	3 kΩ	0.7 V	5 + 6 ⁴⁾				
					f _{min} ⁵⁾	±(%rdg. + d)				
Hz (V)	100.00 Hz	0.01 Hz							Hz (V) ⁶⁾ :	
Hz (A)	1.0000 kHz	0.1 Hz			1 Hz	2)				
	10.000 kHz	1 Hz				$0.05 + 3^{8}$			1000 V	Max. 10 s
Hz (V)	100.00 kHz	10 Hz			10 Hz				Hz (A): 7)	
Hz (A)	30.00 kHz	10 Hz			10 Hz					
MHz	100 Hz 1 MHz	0.01 100 Hz			1 100 Hz	0.05 + 3	> 2 V 5 V			
	2.0 98 %	_	0.01 %	100 Hz 1 kHz	1 Hz	0.1 R	> 2 V 5 V		1000 V	Max. 10 s
%	5.0 95 %	_	0.01 %	10 kHz	1 Hz	0.1 R per kHz	> 2 V 5 V			
	10 90 %	_	0.01 %	100 kHz	1 Hz	0.1 R per kHz	> 2 V 5 V			
						±(%rd	g. + d)			
	Pt100 - 200.0 +850.0 °C					0.3 + 15	5 ⁹⁾		1000 V	
°C/°F	Pt1000 - 150.0 +850.0 °C	0.1 °C				0.3 + 15	5 ⁹⁾		DC/AC RMS	Max. 10 s
	K – 250.0 (NiCr-Ni) +1372.0 °C					1% + 5	K ⁹⁾		sine	

Key: R = measuring range, d= digit(s), rdg. = measured value (reading)

GMC-I Messtechnik GmbH

¹⁾ Values of less than 200 digits are suppressed in the mV range.
15 (20) ... 45 ... 65 Hz ... 20 (1) kHz sinusoidal. See influence error on page 4.
2) At 0° ... + 40° C
3) Displays up to max. 5.1 V, "OL" in excess of 5.1 V.
4) Applies to measurements at film capacitors
5) Assistance measure the frequency for sinusoidal measuring signals symmetrical to the zero point.

⁵⁾ Lowest measurable frequency for sinusoidal measuring signals symmetrical to the zero point 50 Lowest measurable frequency for sinusoidal measuring signals symmetrical to the zero.
 60 Overload capacity of the voltage measurement input: power limiting: frequency x voltage max. 3 x 10⁶ V x Hz for U > 100 V.
 71 Overload capacity of the current measurement input: See current measuring ranges for maximum current values.
 81 Input sensitivity, sinusoidal signal, 10% to 100% of the measuring range.
 92 Phicageographication.

⁹⁾ Plus sensor deviation

¹⁰⁾Residual value deviates within 1 ... 30 d from the zero point due to TRMS converter

when probe tips are short-circuited $^{11)}\rm{Off\text{-}time} > 30$ min and $\rm{T_A} \le 40~^{\circ}\rm{C}$



TRMS-Medical-Multimeter (antimicrobial)

Internal Clock

Time format DD.MM.YYYY hh:mm:ss

Resolution 0.1 s

Accuracy ±1 min. per month

Temperature Influence 50 ppm/K

Influencing Quantities and Influence Error

Influencing Quantity	Sphere of Influence	Measured Quantity / Measuring Range 1)	Influence Error (% rdg. + d) / 10 K
		V 	0.2 + 10
		V ~	0.4 + 10
		100 Ω 1 MΩ	0.5 + 10
	-10° C +21° C and +25° C +50° C	> 1 MΩ	1 + 10
Temperature		mA/A 	0.5 + 10
Temperature		mA/A ≂	0.8 + 10
		10 nF 100 μF	1 + 5
		Hz	0.2 + 10
		°C/°F (Pt100/Pt1000)	0.5 + 10
		°C/°F thermocouple K	0.2 + 10

¹⁾ With zero balancing

Influencing Qty.	Mea	s. Qty. / Meas. Range	Sphere of In	fluence	Intrinsic Uncertainty ³⁾ ±(% rdg. + d)
			> 15 Hz 45	Hz	3 + 30
		100.00 mV	> 65 Hz 1	kHz	2 + 30
			> 1 kHz 10	kHz	3 + 30
		1.0000 V	> 15 Hz 45	Hz	2 + 9
	V _{AC}	100.00 V	> 65 Hz 1	kHz	1 + 9
Frequency			> 1 kHz20	kHz	3 + 9
			> 15 Hz 45	Hz	2 + 9
			> 65 Hz 1	kHz	2 + 9
			> 1 kHz 10	kHz	3 + 30
	A _{AC}	100.00 μΑ	> 15 Hz 45	Hz	0 10
	10	10.0000 A	> 65 Hz 10	kHz	3 + 10

Power limiting: frequency x voltage max. 3×10^6 V x Hz for U > 100 V

³⁾ The accuracy specification for frequency response is valid within a display value range of 10% to 100% of the measuring range for both measuring modes with the TRMS converter in the AC and (AC+DC) ranges.

Influencing Quantity	Sphere of Influence	Measured Quantity/ Measuring Range	Influence Error ⁵⁾
Crest factor CF	1 3	V ~. A ~	± 1 % rdg.
	> 3 5	v ~, A ~	± 3 % rdg.

⁵⁾ Except for sinusoidal waveshape

Influencing Quantity	Sphere of Influence	Measured Quantity	Influence Error
Relative	75%	V A O E II- 00	4
humidity	3 days instrument off	V, A, Ω, F, Hz, °C	1 x intrinsic uncertainty
Battery voltage	1.8 to 3.6 V	ditto	Included in intrinsic uncertainty

Influencing Quantity	Sphere of Influence	Measured Quantity / Measuring Range	Damping
	Interference quantity max. 1000 V \sim	V 	> 120 dB
Common Mode		1 V ∼, 10 V ∼	> 80 dB
Interference Voltage	Interference quantity max. 1000 V \sim 50 Hz 60 Hz, sine	100 V ∼	> 70 dB
	00 NE III 00 NE, 5III0	1000 V ∼	> 60 dB
Series Mode Interference	Interference quantity: V \sim , respective nominal value of the measuring range, max. 1000 V \sim , 50 Hz 60 Hz, sine	V 	> 50 dB
Voltage	Interference quantity max. 1000 V —	V ~	> 110 dB

Reference Conditions

Ambient temperature $+23 \,^{\circ}\text{C} \pm 2 \,^{\circ}\text{K}$ Relative humidity $40 \,^{\circ}$... 75% Measured qty. frequency $45 \,^{\circ}$... 65 Hz Measured qty. waveshape Sine Battery voltage $3 \,^{\circ}\text{V} \pm 0.1 \,^{\circ}\text{V}$

Response Time (after manual range selection)

Measured Quantity / Measuring Range	Response Time Digital Display	Measured Quantity waveshape	
V == , V ~ AV == , A ~	1.5 s	From 0 to 80% of upper range limit value	
100 Ω 1 MΩ	2 s		
10/40 MΩ	5 s		
Continuity	< 50 ms	From ∞ to 50% of upper range limit value	
°C (Pt 100)	Max. 3 s	or apportanted in the value	
→	1.5 s		
10 nF 100 μF	Max. 2 s		
1 000 μF	Max. 7 s	From 0 to 50% of upper range limit value	
>10 Hz	1.5 s	o. apportango initi valuo	

Data Interface

Type
Data transmission
Protocol

Optical via infrared light through the housing Serial, bidirectional (not IrDa compatible)

Protocol Device specific Baud rate 38,400 baud

Functions - Select/query measuring functions

and parametersQuery momentary measurement data

Query momentary measurement data
Read out stored measurement data

The USB X-TRA plug-in interface adapter (see accessories) is used for adaptation to the PC's USB port.

Internal Measured Value Storage

Memory capacity 4 MBit / 540 kB for approx. 15,400

measured values with date and time stamp

TRMS-Medical-Multimeter (antimicrobial)

Power Supply

Battery 2 ea. 1.5 V mignon cell (2 ea. size AA),

alkaline manganese per IEC LR6 (2 ea. 1.2 V NiMH rechargeable battery

also possible)

Service life with alkaline manganese: approx. 200 hours
Battery test Battery capacity display with battery

Battery capacity display with battery symbol in 4 segments:

Querying of momentary battery voltage via

menu function.

Power OFF function Multimeter is switched off automatically:

If battery voltage drops to below prox. 1.8 V
If none of the keys or the rotary switch

are activated for an adjustable duration of 10 to 59 minutes, and the multimeter is not in the continuous operation mode

Power pack socket

If the NA X-TRA power pack has been plugged into the instrument, the batteries

are disconnected automatically. Rechargeable batteries can only be recharged externally.

Display

LCD panel (65 mm \times 36 mm) with analog and digital display including unit of measure, type of current and various special functions

Background illumination

Background illumination is switched off approximately 1 minute after it has been activated.

Analog

Display LCD scale with bar graph or pointer, depend-

ing on the selected parameter setting

Scaling With 4 division lines each, 1 bar/pointer cor-

responds to 500 digits at the digital display

Polarity display With automatic switching

Overflow display With the ▶ symbol

Measuring rate 40 measurements per second and display

refresh

Digital

Display / char. height 7-segment characters / 15 mm

Overflow display "OL" is displayed for ≥12,000 digits
Polarity display "-" (minus sign) is displayed

Polarity display "-" (minus sign) is displayed if plus pole is connected to "⊥"

Measuring rate 10 and 40 measurements per second with

the Min-Max function except for the capacitance, frequency and keying ratio

measuring functions

Refresh rate 2 times per sec., every 500 ms

Acoustic Signals

For voltage Intermittent signal at above 1000 V
For current Intermittent signal at above 10 A
continuous signal at above 16 A

Fuse

Fuse FF (UR) 10 A/1000 V AC/DC;

10 mm x 38 mm,

Switching capacity: 30 kA at 1000 V AC/DC, protects the current measurement input in the 100 μ A through 10 A ranges

Electrical Safety

Per IEC 61010-1:2010/VDE 0411-1:2011

Safety class II

Measuring category III IV
Operating voltage 600 V 300 V

Fouling factor 2
Test voltage 6.7 kV~

Electromagnetic Compatibility (EMC)

Interference emission EN 610326-1: 2006, class B

Interference immunity EN 610326-1: 2006

EN 610326-2-1: 2006

Ambient Conditions

Accuracy range $0 \, ^{\circ}\text{C} \dots +40 \, ^{\circ}\text{C}$ Operating temp. range $-10^{\circ}\text{C} \dots +50^{\circ}\text{C}$

Storage temp. range -25° C ... $+70^{\circ}$ C (without batteries) Relative humidity Max.75%, no condensation allowed

Elevation To 2000 m

Deployment Indoors, except within specified ambient

conditions

Mechanical Design

Housing Impact resistant plastic (ABS)

Dimensions 200 x 87 x 45 mm

(without protective rubber cover)
Approx. 0.35 kg with batteries

Weight Approx. 0.35 kg with batteries
Protection Housing: IP 52 (pressure equalization by

means of the housing)

Table excerpt regarding significance of the IP code

	IP XY (1 st digit X)	Protection against penetra- tion of solid particles	IP XY (2 nd digit Y)	Protection against penetration by water
l	5	Dust protected	2	Dripping (15° inclination)

GMC-I Messtechnik GmbH 5

TRMS-Medical-Multimeter (antimicrobial)

Accessories for Operation at a PC

Interface Adapter for USB Connection

The USB X-TRA bidirectional interface adapter includes the following functions:

- Configure the **SECULIFE HITAM** from a PC.
- Transmit live measurement data to the PC.
- Read out data from memory at the SECULIFE HITAM.

The adapter does not require a separate power supply.

Its baud rate is 38,400 baud. A CD ROM is included which contains current drivers for Windows operating systems.



METRAwin®10/METRAHit® Software

METRAwin[®] 10/METRAHit [®] PC software is a multilingual, measurement data logging program for recording, visualizing and documenting measured values from **SECULIFE HITAM** multimeters.

Communication between the PC and the measuring instrument(s) is established via available interfaces and memory adapters. Telephone modems can be interconnected as well.

Depending upon device type, one or several of the following operating modes are possible:

Device Configuration

Remote configuration and querying of device-specific functions and parameters, for example measuring function, measuring range and memory parameters. Frequently used device settings can be saved to configuration files for easy recall.

. Online Recording of Measurement Data

Read-in, display and recording of momentarily measured data from the interconnected device.

- Number of

measuring channels up to 10

Start recording

manual, triggered by measured value, time triggered

- Recording mode


- > time controlled with sampling interval of 0.05 s* ... 1 s ... 60 min
- > manually controlled
- > measured value controlled in event of exceeded limit/delta value
- Recording duration max. 10 million intervals
- * Depending upon device type, measuring function, number of measuring channels and communication (e.g. via modem), sample intervals of less than 1 s cannot be used.

Reading Out and Visualizing Stored Data


If supported by the device: read-in and display of offline data recorded to device memory.

For purposes of analysis, data recorded online or read in from the device's memory can be displayed in various formats:


Y(t)-recorder display for up to 6 channels

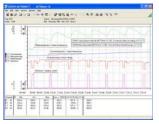

XY-recorder display for up to 4 channels

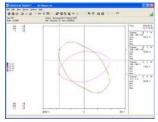

Multimeter-display for up to 4 channels

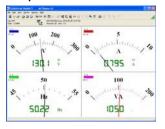

Tabular display for up to 10 channels



System Requirements

METRAwin 10 (as from version 6.0) can be run on IBM compatible PCs with Microsoft Windows $^{\tiny (\!R\!)}$ XP, VISTA, 7 and 8.

TRMS-Medical-Multimeter (antimicrobial)

Order Information

Designation	Туре	Article Number
4½-place (12,000 digits) TRMS multimeter with direct, alternating and pulsating voltage measurement (TRMS values), frequency measurement, resistance measurement, continuity test, diode measurement and temperature measurement with type K thermocouples, precision temperature measurement with Pt100 or Pt1000 platinum resistance thermometers, frequency and keying ratio measurement, broad range capacitance measurement, LCD with 15 mm characters, analog bar graph and background illumination Measuring categories: 300 V/CAT IV, 600 V/CAT III, with power pack socket and IR interface, 4 MB data memory	SECULIFE HITAM	M687A
Accessories for operation at a PC		
IR-USB bidirectional interface adapter	USB X-TRA	Z216C
METRAwin10 software	METRAwin10	GTZ3240000R0001
Accessories for temp. measurement with	resistance thermome	ter
Pt100 temperature sensor for surface and immersion measurement, -40 to +600° C	Z3409	GTZ3409000R0001
Pt1000 temperature sensor for measurement in gases and liquids, -50 to +220° C	TF220	Z102A
Pt100 oven sensor, -50 to +550° C	TF550	GTZ3408000R0001
Ten adhesive Pt100 temperature sensors, -50 to +550° C	TS Chipset	GTZ3406000R0001
Replacement fuse		
Fuses (pack of 10)	FF (UR) 10 A / 1000 V AC/DC	Z109L
Power pack	NA X-TRA	Z218G



Transport Accessories

HitBag Cordura Belt Pouch

For multimeters (with/without protective rubber cover)



HC20 Hard Case

For multimeter (with/without protective rubber cover) and accessories



F836 Ever-Ready Case

For multimeter and accessories



F829 Carrying Pouch For multimeters (with/without protective rubber cover)



Designation	Туре	Article Number
Imitation leather carrying pouch	F829	GTZ3301000R0003
Cordura belt pouch	HitBag	Z115A
Imitation leather ever-ready case with cable compartment	F836	GTZ3302000R0001
Ever-ready case for 2 SECULIFE HITAM, 2 adapters and accessories	F840	GTZ3302001R0001
Hard case for one SECULIFE HITAM and accessories	HC20	Z113A
Hard case for two SECULIFE HITAM and accessories	HC30	Z113A

For additional information regarding accessories please refer to:

- our Measuring Instruments and Testers catalog.
- our website www.gossenmetrawatt.com

GMC-I Messtechnik GmbH

TRMS-Medical-Multimeter (antimicrobial)

All current :	sensors and transformers are e	quipped with a connecto	r cable (1.2 to	1.5 m long) with 4 mm safety	banana plugs		
Туре	Designation	Measuring Range	Meas. Category	Max. Wire Dia	Transformation Factor	Frequency Range	Intrinsic Uncertainty ±(% rdg. +)	Article Number
DC/AC Cur	rent Sensors with Voltage Ou	tput						
CP30	DC/AC clip-on current sensor, with battery mode (30 h)	5 mA to 30 A (DC / AC pk)	300 V / CAT III	25 mm	100 mV/A	DC20 kHz (-3 dB)	1 % +2 mA	Z201B
CP330	DC/AC clip-on current sensor, with 2 measuring ranges, battery mode (50 h)	Range: 0.5 30 A Range: 5 300 A (DC / AC rms)	300 V / CAT III	25 mm	10 mV/A; 1 mV/A	DC20 kHz (-3 dB)	1 % + 50 mA 1 % + 100 mA	Z202B
CP1100	DC/AC clip-on current sensor, with 2 measuring ranges, battery mode (50 h)	Range: 0.5 100 A Range: 5 1000 A (DC / AC rms)	300 V / CAT III	32 mm	10 mV/A; 1 mV/A	DC20 kHz (-1 dB)	1 % + 100 mA 1 % + 500 mA	Z203B
CP1800	DC/AC current clamp sensor, with 2 measuring ranges, battery mode (50 h)	Range: 0.5 125 A Range: 5 1250 A (DC / AC rms)	300 V / CAT III	32 mm	10 mV/A, 1 mV/A	DC 20 kHz (-1 dB)	1% + 100 mA 1% + 500 mA	Z204A
AC Current	t Sensors with Voltage Output	t						
WZ12B	AC clip-on current sensor	10 mA~ 100 A~	300 V / CAT III	15 mm	100 mV/A	45 65 500 Hz	1.5% +0.1 mA	Z219B
WZ12C	AC clip-on current sensor, with 2 measuring ranges	1 mA~ 15 A~, 1 150 A~	300 V / CAT III	15 mm	1 mV/mA, 1 mV/A	<u>45 65</u> 400 Hz	3% + 0.15 mA, 2% + 0.1 A	Z219C
WZ11B	AC clip-on current sensor, with 2 measuring ranges	0.5 20 A~, 5 200 A~	600 V / CAT III	20 mm	100 mV/A, 10 mV/A	30 <u>48 65</u> 500 Hz	1 3%	Z208B
Z3512A	AC clip-on current sensor, with 4 measuring ranges	1 mA 1/10/100/ 1000 A~	600 V / CAT III	52 mm	1 V/A, 100 mV/A, 10 mV/A, 1 mV/A	10 <u>48 65</u> 3 kHz	0.5 3%, 0.2 1%	Z225A
METRAFLE X3000	Flexible AC current sensor with 3 measuring ranges, battery mode (2000 h)	0,5 30 A, 0,5 300 A, 5 3000 A	1000 V CAT III 600 V CAT IV	176 mm	100 mV/A, 10 mV/A, 1 mV/A	10 Hz 20 kHz	1% + 0.1 A 1% + 0.1 A 1% + 1 A	Z207E
METRAFLE X300M	Flexible AC miniature current sensor with 3 measuring ranges, battery mode (150 h)	1 3 A, 1 30 A, 5 300 A	1000 V CAT III 600 V CAT IV	50 mm	1 V/A, 100 mV/A, 10 mV/A	20 Hz 100 kHz	1% + 0.2 A 1% + 0.2 A 1% + 1 A	Z207M
AC Current	t Transformer with Current Ou	ıtput						
WZ12A	AC clip-on current transformer	15 180 A~	300 V / CAT III	15 mm	1 mA/A	45 65 400 Hz	3%	Z219A
WZ12D	AC clip-on current transformer	30 mA 150 A~	300 V / CAT III	15 mm	1 mA/A	45 65 500 Hz	2.5% +0.1 mA	Z219D
WZ11A	AC clip-on current transformer	1 200 A~	600 V / CAT III	20 mm	1 mA/A	48 65 400 Hz	1 3%	Z208A
Z3511	AC clip-on current transformer	4 500 A~	600 V / CAT III	30 x 63 mm	1 mA/A	<u>48 65</u> 1 kHz	3% +0.4 A	GTZ3511 000R0001
Z3512	AC clip-on current transformer	0.5 1000 A~	600 V / CAT III	52 mm	1 mA/A	30 <u>48 65</u> 5 kHz	0.5% 0.7%	GTZ3512 000R0001
Z3514	AC clip-on current transformer	1 2000 A ~	600 V / CAT III	64 x 150 mm	1 mA/A	30 <u>48 65</u> 5 kHz	0.5% +0.1 A	GTZ3514 000R0001
Shunt Res	istors for Multimeters withou	t Current Measuring F	unction			-		
NW300mA	Plug-in shunt resistor, encapsulated 1 Ω	0 300 mA	300 V / CAT III	_	1 mV/mA	DC10 kHz	0.5%	Z205C
NW3A	Plug-in shunt resistor, encapsulated 0,1 Ω	0 3 A	300 V / CAT III		100 mV/A	DC10 kHz	0.5%	Z205B

Prepared in Germany • Subject to change without notice • PDF version available on the Internet

